

Manhole Inspection Summary

Manhole # S04UU1005MH

Printed On: 6/24/2010

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **04UU1** Node: **005** Status: **Found**

Insp Date: **11/8/07 1:02 PM**

Incomplete Comments

Crew: **RL, TJ**
Inspector: **Lamont**
Firm: **URS**

Location Address: **4206 FORDS LN** Cross Street: **FAIRLAWN AVE**

Manhole Type: **Inline** Location: **Roadway** Ground Conditions: **Dry**
☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)
Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**
Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☒ Exists Material: **Brick** ☐ Parged Height: **4** (in.)
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated
Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated
Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☐ Parged
Shape: **Circular** Diameter: **48** (in.) Length: (in.)
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated
Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged
Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **7** Missing: **0** ☒ **Corroded**

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Location View



Top View



GRADE ADJUSTMENT



Manhole Inspection Summary

Manhole # S04UU1005MH

Printed On: 6/24/2010

Page 3 of 4

10 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **10.8** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **12.72** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

10 in. Circular Gravity Sewer
Pipe In @ 3 O'Clock

3 O'Clock Inflow



Pipe Height: **10.8** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **12.56** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Stub connection / abandoned**


☐ Possible Illicit Connection

10 in. Circular Gravity Sewer

Pipe In @ 6 O'Clock

6 O'Clock Inflow

Drop In @ 6 O'Clock

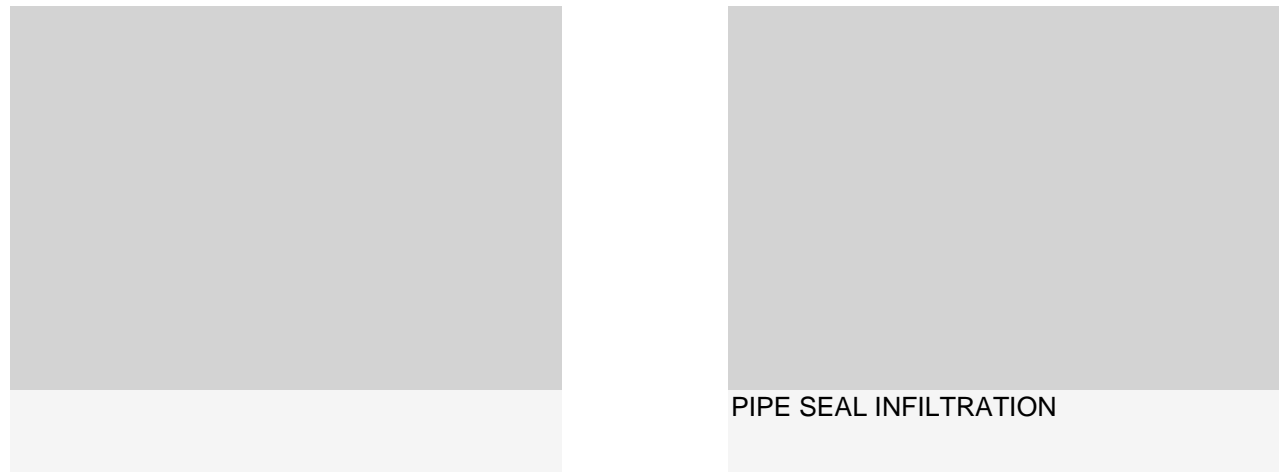

Pipe Height: 10.8 (in.) Rod and Bar (Angled)

Pipe Material: Clay ☐ Pipe Lined

Invert Depth: 9.12 (ft.) Flow Characteristics: Fast

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: Evidence Pipe Seal Cond: Sound

Drop: Outside Rod and Bar

Angled: Yes Reading: 11.56 (ft.)

Inv Depth: 12.56 (ft.)

Drop Condition: Open

Connects To: Manhole

☐ Possible Illicit Connection